

OPERATOR'S MANUAL



TRUCHECK™ 2 & TRUCHECK™ 2 PLUS



CONTENTS

Part Numbers Covered by This Manual	2
Set Up Instructions	2
TruCheck™ 2 & TruCheck™ 2 Plus (0.1 – 30 N·m)	2
TruCheck™ 2 & TruCheck™ 2 Plus (3 – 2,100 N·m)	2
Operating Instructions – TruCheck™ 2 Plus	3
Measurement Screen	3
Units Menu	4
Click Menu	4
Target Menu	4
Version Screen	5
Set Up Menu	5
Zero Resetting	5
Active From Setting	5
Target Indication	6
Using the Instrument	7
USB Port	7
Operating Instructions – TruCheck™ 2	8
Measurement Screen	8
Using the Instrument	8
Version Screen	8
Set Up Menu	9
Track Mode	9
Zero Resetting	9
Calibrate Mode	9
USB Port	9
Specifications	10
TruCheck™ 2 & TruCheck™ 2 Plus (0.1 – 30 N·m)	10
TruCheck™ 2 & TruCheck™ 2 Plus (3 – 2,100 N·m)	11
Calibration	13
Repair	13
Cleaning	13
Warning	13
Disposal	13

PART NUMBERS COVERED BY THIS MANUAL

This manual covers the set up and use of Norbar TruCheck™ 2 & TruCheck™ 2 Plus instruments.

Part Number	Model
43514	TruCheck™ 2, 3 N·m
43515	TruCheck™ 2 Plus, 3 N·m
43516	TruCheck™ 2, 10 N·m
43517	TruCheck™ 2 Plus, 10 N·m
43518	TruCheck™ 2, 30 N·m
43563	TruCheck™ 2 Plus, 30 N·m
43520	TruCheck™ 2, 65 N·m
43521	TruCheck™ 2 Plus, 65 N·m
43522	TruCheck™ 2, 260 lbf·ft
Part Number	Model
43523	TruCheck™ 2 Plus, 260 lbf·ft
43524	TruCheck™ 2, 350 N·m
43525	TruCheck™ 2 Plus, 350 N·m
43528	TruCheck™ 2, 800 lbf·ft
43529	TruCheck™ 2 Plus, 800 lbf·ft
43530	TruCheck™ 2, 1,100 N·m
43531	TruCheck™ 2 Plus, 1,100 N·m
43532	TruCheck™ 2, 2,100 N·m
43533	TruCheck™ 2 Plus, 2,100 N·m

SET UP INSTRUCTIONS

TruCheck™ 2 & TruCheck™ 2 Plus (0.1 – 30 N·m)

1. Identify a suitable surface and position to mount the instrument.
2. Drill two mounting holes suitable for M6 fasteners (M6 Cap Screws of grade 8.8 minimum are recommended).
3. Recommended fastener torque of 7.3 to 8.4 N·m (5.4 to 6.2 lbf·ft).
4. After connecting the provided power supply the instrument will be ready to use after approximately 12 seconds.

TruCheck™ 2 & TruCheck™ 2 Plus (3 – 2,100 N·m)

1. Identify a suitable surface and position to mount the instrument.
2. Drill two mounting holes suitable for M10 fasteners (M10 Cap Screws of grade 12.9 minimum are recommended).
3. Recommended fastener torque of 35 to 40 N·m (25 to 30 lbf·ft).
4. After connecting the provided power supply the instrument will be ready to use after approximately 12 seconds.



WARNING: ENSURE THE MOUNTING SURFACE IS CAPABLE OF SUPPORTING THE INSTRUMENT WHEN THE RATED CAPACITY TORQUE IS APPLIED.

ONLY USE THE POWER SUPPLY PROVIDED.

DO NOT APPLY TORQUE ABOVE THE RATED CAPACITY.

TruCheck™ 2 & TruCheck™ 2 Plus are intended for testing torque tools only.

OPERATING INSTRUCTIONS – TRUCHECK™ 2 PLUS

(43515, 43517, 43563, 43521, 43523, 43525, 43529, 43531 & 43533)

Measurement Screen



Changes the Units of Measurement
(N·m, lbf·ft and lbf·in etc.).

To enable/disable units, use the UNITS MENU (Press and Hold).



Changes the Selected Target
(T01 XXX.X, T02 XXX.X etc.).
Units are automatically changed to the targets units.

NOTE: T-- ---- means Targets are OFF.

To edit targets, use the TARGET MENU (Press and Hold).



Changes the Mode of Operation
(Track, Click and Dial).

To change Click Mode settings, use the CLICK MENU (Press and Hold).



Resets a captured peak
in Dial Mode (and Click Mode if set to Manual Reset).

Zeroes the reading
in Track Mode if reading <4% Full Scale Deflection (FSD).
In Click and Dial Mode if reading <1% FSD.

Units Menu

Units Menu			
N·m	✓	lbf·ft	✓
dN·m	✗	lbf·in	✓
cN·m	✗	ft·lb	✗
kgf·m	✗	in·lb	✗
kgf·cm	✗	ozf·in	✗
gf·m	✗	in·oz	✗



Select units to enable / disable.



Toggle enable / disable (✓ or ✗).



Select  and press  to save and exit.

 Cancel (exit without saving changes).

NOTE: Units which can be enabled are TruCheck™ 2 Plus model specific (see Technical Specification).

Click Menu

Click Menu		
Sensitivity	High	
Reset	Auto	
Hold Time	3 s	



Select menu item (e.g. Sensitivity).



Confirm item.



Change setting (e.g. High to Medium).



Confirm setting.



Select  and press  to save and exit.

 Cancel (exit without saving changes).

Setting Options

Sensitivity: High / Medium / Low.

Reset: Auto / Manual.

Hold Time: 1 sec / 2 sec / 3 sec.

Target Menu

Target Menu		
#	01	
Units	N·m	
Value	200.0	
±%	03	



Select menu item (e.g. Units).



Confirm item.



Change setting (e.g. N·m to lbf·ft).



Confirm setting.



Select  and press  to save and exit.

 Cancel (exit without saving changes).

Setting Options

(Target No.): 01 – 15.


Units: N·m / lbf·ft / etc.

Value: 0 or 2 – 100% Capacity (e.g. 7.0 – 350.0).

±% (Tolerance): 1 – 15%.

- When changing the target value, you can press and hold the buttons to speed up the change
- When you change the target units, the target value will change to suit
- Setting the target value to '0' disables it meaning it won't be selectable in the measure screen.

Version Screen

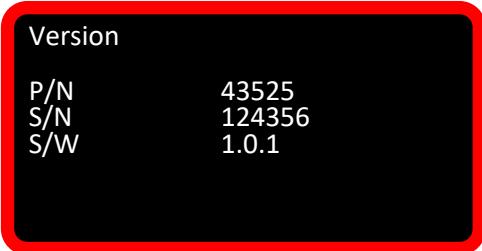

Press and hold  from the measurement screen to view the version screen.

The version screen contains:

P/N (Part Number of the TruCheck™2 Plus).

S/N (Serial Number).


S/W (Software Version Number).

Press  to return to the measurement screen.

or

Press  to enter the set up menu.

Set Up Menu

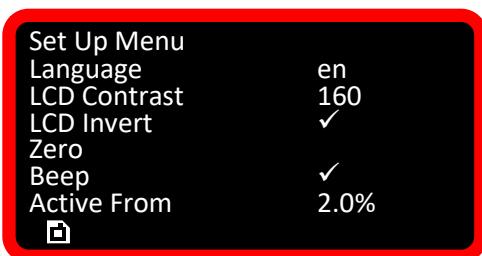

 Select menu item (e.g. Language).

 Confirm item.

 Change setting (e.g. en to fr).

 Confirm setting.

Select  and press  to save and exit.

 Cancel (exit without saving changes).

Setting Options

Language: en / fr / de / it / da / es / fi / sv / no / pt.

LCD Contrast: 1 – 255 (Default 160).

LCD Invert: Invert (✓) or non-invert (✗).

Zero: Reset the stored Zero value.

Beep: Enable (✓) or disable (✗).

Active From: 2.0 to 40.0 % (default 2.0%).

Zero Resetting

Zero resetting should only be performed if the TruCheck™ 2 Plus won't zero in Track mode. If this is the case the transducer may have been overstrained.

If the reading is unstable the TruCheck™ 2 Plus should be returned to a supplier approved agent for repair. It is recommended to get the TruCheck™ 2 Plus recalibrated as soon as possible after resetting the zero. Make sure no torque is being applied to the TruCheck™ 2 Plus and remove any tools from the input drive when resetting the zero.

Active From Setting

This is the percentage of capacity at which Click mode and Dial mode will start to capture peak values.

Target Indication


When a target is selected, the TruCheck™ 2 Plus will indicate whether a reading is Low, Pass or High in three different ways:

1. Text colour (Low = Yellow, Pass = Green, High = Red).
2. Target icons (Low = ▼, Pass = ✓, High = ▲).
3. Target indicator line.


Example

Target 1 (T01) Set to **200.0 N·m $\pm 3\%$** (194.0 – 206.0 N·m).
Mode set to **Click**.


First Reading 190.7 N·m (LOW).

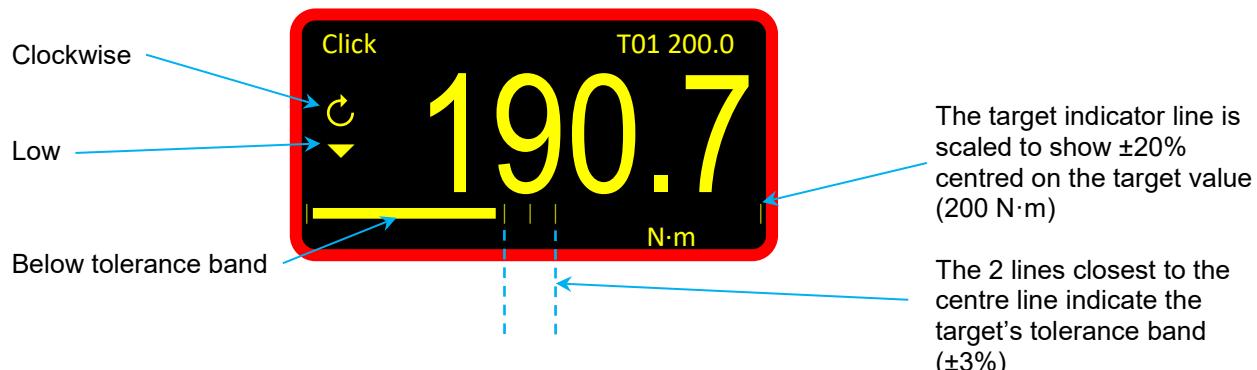

Second Reading 202.1 N·m (PASS).

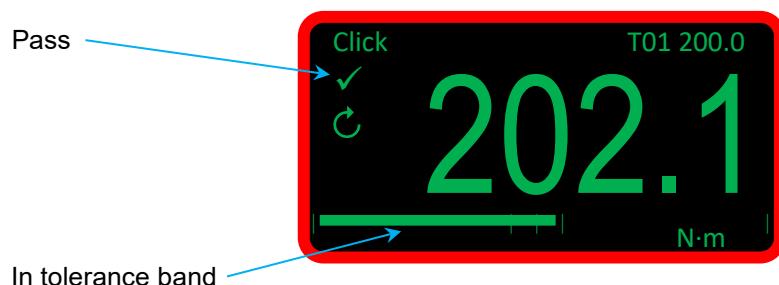

Third Reading 212.4 N·m (HIGH).

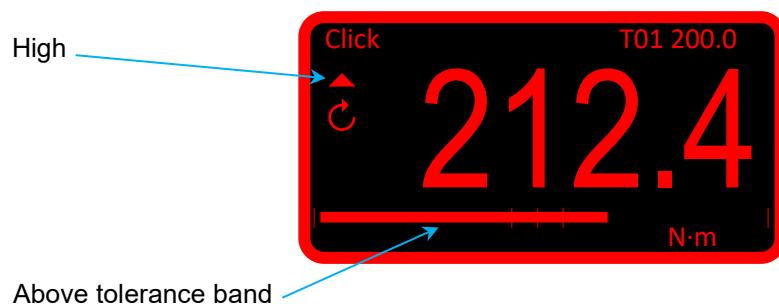

Using the Instrument

1. Select mode of operation.
2. Select target.
3. Select units.
4. Place torque screwdriver / torque wrench in the input drive and operate in the desired direction.
5. Remove the torque screwdriver / torque wrench and zero the display (if required) by pressing the RESET button.
6. Place the torque screwdriver / torque wrench in the input drive and operate in the desired direction.

USB Port

The USB port provides the power for the TruCheck™ 2 Plus. The supplied USB lead can also be used to connect the TruCheck™ 2 Plus to a PC for communication of torque readings.

Connect the TruCheck™ 2 Plus to the PC and a virtual com port will appear in device manager. This com port should be selected and configured to suit the program being used to display the torque readings.

Torque readings will be sent to the PC whenever the RESET button is pressed in any mode and when a peak value is reset (either manually using the RESET button in Dial or Click mode or when auto-reset triggers in Click mode).

If the PC doesn't detect the TruCheck™ 2 Plus correctly (e.g. if running Windows 7 rather than Windows 10) download the USB driver from the Norbar website.

The USB port can also be used to update the TruCheck™ 2 Plus software.


For the USB driver and to update the TruCheck™ 2 software visit:

<https://www.norbar.com/Downloads/Software-Download/Trucheck2>

OPERATING INSTRUCTIONS – TRUCHECK™ 2

(43514, 43516, 43518, 43520, 43522, 43524, 43528, 43530 & 43532)


Measurement Screen

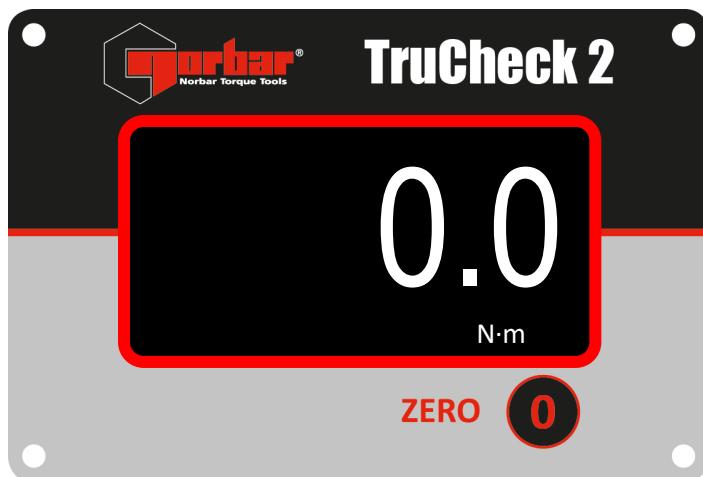

Using the Instrument

1. Place torque screwdriver / torque wrench in the input drive and operate in the desired direction.
2. Remove the torque screwdriver / torque wrench and zero the display (if required) by pressing the ZERO button.
3. Place the torque screwdriver / torque wrench in the input drive and operate in the desired direction.

Version Screen

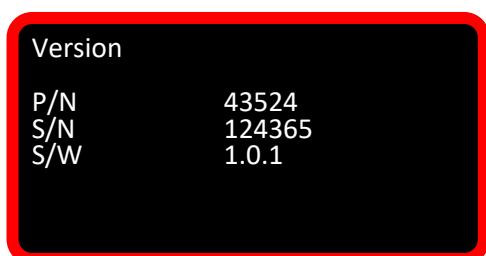

Press and hold the ZERO button from the measurement screen to view the version screen.

The version screen contains:

P/N (Part Number of the TruCheck™ 2).

S/N (Serial Number).

S/W (Software Version Number).

Press the ZERO button to return to the measurement screen.

or

Press and hold the ZERO button for 5 seconds to enter the set up menu.

Set Up Menu

Setup Menu	
LCD Invert	✓
Beep	✓
Track	✗
Zero	
Calibrate	
X	
	

Press the ZERO button to select the menu item.

Press and hold the ZERO button to confirm / toggle the menu item.

Setting Options

LCD Invert: Invert (✓) or non-invert (✗).

Beep: Enable (✓) or disable (✗).

Track: Put the TruCheck™ 2 into Track mode.

Zero: Reset the stored Zero value.

Calibrate: Put the TruCheck™ 2 into Calibrate mode.

X: Exit without saving changes.

 Save changes and exit.

Track Mode

Pressing and holding the ZERO button on 'Track' will put the TruCheck™ 2 into Track mode. The TruCheck™ 2 will remain in Track mode until it is disabled in the set up menu or is power cycled. The TruCheck™ 2 will always power up in its default mode (Click mode).

Zero Resetting

Zero resetting should only be performed if the TruCheck™ 2 won't zero. If this is the case the transducer may have been overstrained.

If the reading is unstable the TruCheck™ 2 should be returned to a supplier approved agent for repair. It is recommended to get the TruCheck™ 2 recalibrated as soon as possible after resetting the zero.

Make sure no torque is being applied to the TruCheck™ 2 and remove any tools from the input drive when resetting the zero.

Calibrate Mode

Only to be used by a supplier approved agent.

USB Port

The USB port provides the power for the TruCheck™ 2.

The USB port can also be used to update the TruCheck™ 2 software.

For the USB driver (if required) and to update the TruCheck™ 2 software visit:





<https://www.norbar.com/Downloads/Software-Download/Truchek2>

SPECIFICATIONS

TruCheck™ 2 & TruCheck™ 2 Plus (0.1 – 30 N·m)

Part Number	Model	Transducer Input	Capacity	Max Torque
43514	TruCheck™ 2, 3 N·m	1/4" Male Hex Drive	0.1 – 3 N·m	3.6 N·m
43515	TruCheck™ 2 Plus, 3 N·m	1/4" Male Hex Drive	0.1 – 3 N·m	3.6 N·m
43516	TruCheck™ 2, 10 N·m	1/4" Male Hex Drive	0.5 – 10 N·m	12 N·m
43517	TruCheck™ 2 Plus, 10 N·m	1/4" Male Hex Drive	0.5 – 10 N·m	12 N·m
43518	TruCheck™ 2, 30 N·m	10 mm Male Hex Drive	1.5 – 30 N·m	36 N·m
43563	TruCheck™ 2 Plus, 30 N·m	10 mm Male Hex Drive	1.5 – 30 N·m	36 N·m

Part Number	Dimensions (mm)										Weight (kg)
	A	B	C	D	E	F	G	ØH	J	K	
43514	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4
43515	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4
43516	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4
43517	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4
43518	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4
43563	175	63.5	63.5	37.5	30	8.5	55	6.5	10	10	1.4

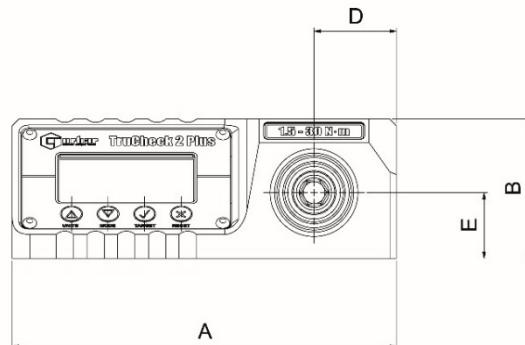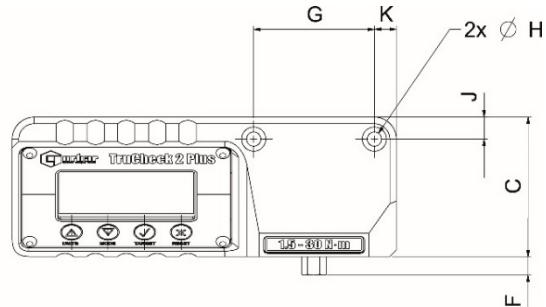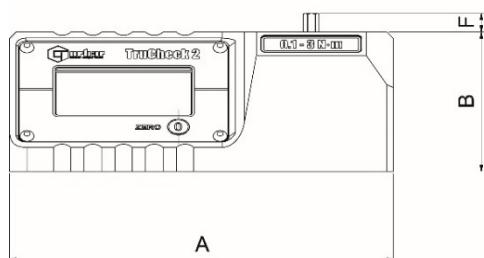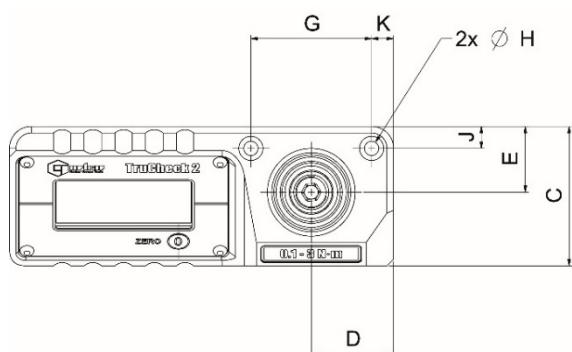



3 N·m & 10 N·m MODELS

30 N·m MODEL

TruCheck™ 2 & TruCheck™ 2 Plus (3 – 2,100 N·m)

Part Number	Model	Transducer Input	Capacity	Max Torque
43520	TruCheck™ 2, 65 N·m	3/8" Female Square Drive	3 – 65 N·m	78 N·m
43521	TruCheck™ 2 Plus, 65 N·m	3/8" Female Square Drive	3 – 65 N·m	78 N·m
43522	TruCheck™ 2, 260 lbf·ft	1/2" Female Square Drive	10 – 260 lbf·ft	312 lbf·ft
43523	TruCheck™ 2 Plus, 260 lbf·ft	1/2" Female Square Drive	10 – 260 lbf·ft	312 lbf·ft
43524	TruCheck™ 2, 350 N·m	1/2" Female Square Drive	10 – 350 N·m	420 N·m
43525	TruCheck™ 2 Plus, 350 N·m	1/2" Female Square Drive	10 – 350 N·m	420 N·m
43528	TruCheck™ 2, 800 lbf·ft	27 mm Male Hex Drive	40 – 800 lbf·ft	960 lbf·ft
43529	TruCheck™ 2 Plus, 800 lbf·ft	27 mm Male Hex Drive	40 – 800 lbf·ft	960 lbf·ft
43530	TruCheck™ 2, 1,100 N·m	27 mm Male Hex Drive	50 – 1,100 N·m	1,320 N·m
43531	TruCheck™ 2 Plus, 1,100 N·m	27 mm Male Hex Drive	50 – 1,100 N·m	1,320 N·m
43532	TruCheck™ 2, 2,100 N·m	27 mm Male Hex Drive	200 – 2,100 N·m	2,310 N·m
43533	TruCheck™ 2 Plus, 2,100 N·m	27 mm Male Hex Drive	200 – 2,100 N·m	2,310 N·m

Part Number	Dimensions (mm)												Weight (kg)
	A	B	C	D	E	F	G	ØH	J	K	L	M	
43520	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.6
43521	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.6
43522	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.7
43523	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.7
43524	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.7
43525	138	117	110	40	40	119	80	10.5	18.5	57.5	59	N/A	2.7
43528	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5
43529	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5
43530	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5
43531	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5
43532	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5
43533	138	132.5	120	40	47.5	144	95	10.5	19	68	67	25	3.5

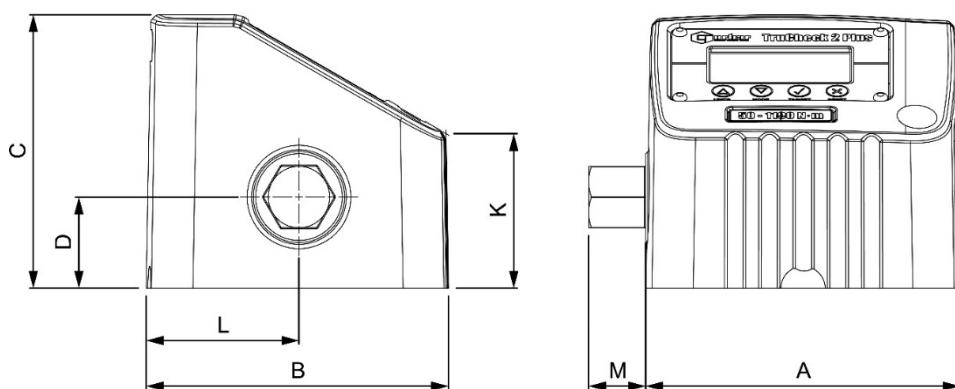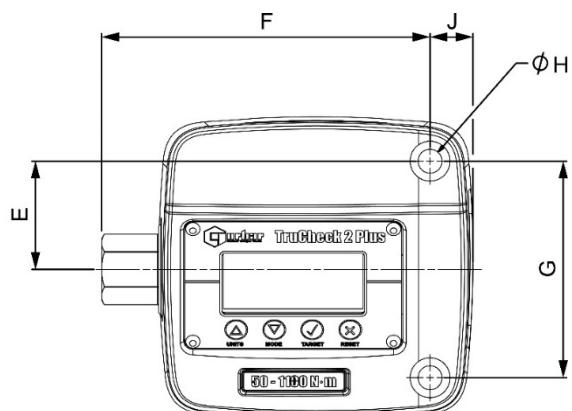

Display:	128 x 64 pixel RGB backlit LCD.
Display update rate:	5 readings per second (5Hz).
Resolution:	4 digits.
Zero suppression:	None.
Accuracy:	See calibration certificate (Nominally $\pm 1\%$ of reading).
Units of measurement:	Available units dependant on specific TruCheck™ 2 Plus model (please see table below).

Part Number	Model Size	Units of Measurement											
		N·m	dN·m	cN·m	kgf·m	kgf·cm	gf·m	lbf·ft	lbf·in	ft·lb	in·lb	ozf·in	in·oz
43515	3 N·m	✓	✓	✓		✓	✓	✓	✓	✓	✓	✓	✓
43517	10 N·m	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
43563	30 N·m	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
43521	65 N·m	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓	✓
43523	260 lbf·ft	✓	✓		✓	✓		✓	✓	✓	✓		✓
43525	350 N·m	✓	✓		✓	✓		✓	✓	✓	✓		
43529	800 lbf·ft	✓			✓			✓	✓	✓	✓		✓
43531	1,100 N·m	✓			✓			✓	✓	✓	✓		
43533	2,100 N·m	✓			✓			✓		✓			

Auto reset hold time:	3 seconds (Plus models – 1, 2 or 3 seconds).
AC power adapter:	90 to 264 Volts AC at 47 – 63 Hz input (World). Interchangeable mains connectors included. Energy Efficiency Level VI. 5V, 1,000 mA DC USB A output connector.
Power consumption:	0.5 W – maximum.
Operating temperature range:	0°C to +50°C.
Storage temperature range:	-20°C to +70°C.
Maximum operating humidity:	85% relative humidity at 30°C.
Environment:	IP 40. Indoor use within a light industrial environment.
Maximum working torsion:	120% of rated capacity (except 2,100 N·m @ 110%).
Absolute maximum torsion:	150% of rated capacity (except 2,100 N·m @ 110%).
Case materials / finish:	Powder coated aluminium housing. Stainless steel transducer shaft.
Electromagnetic Compatibility:	Designed to comply with EN 61326-1.
Low Voltage Directive	Designed to comply with EN 61010-1. TRANSIENT OVERVOLTAGES up to the levels of OVERVOLTAGE CATEGORY II.

NOTE: Due to continuous improvement all specifications are subject to change without prior notice.

CALIBRATION

Your instrument has been supplied with a clockwise certificate of calibration. To maintain the specified accuracy, it is recommended that the instrument is recalibrated at least once per year. Recalibration should be carried out by the supplier or by a supplier approved agent, where all the facilities to ensure the instrument is functioning at maximum accuracy are available.

IMPORTANT: DO NOT REMOVE FRONT PANEL AS THERE ARE NO CALIBRATION SETTINGS INSIDE.

REPAIR

Repair should be carried out by the supplier or by a supplier approved agent, where all the facilities to ensure the instrument is functioning at maximum accuracy are available.

There are no parts for user repair inside the case.

CLEANING

Do not use abrasives or solvent-based cleaners.

WARNING

If the instrument is used in a manner not specified by the manufacturer, the protection provided by the equipment may be impaired.

DISPOSAL



This symbol on the product indicates that it must not be disposed of in the general waste.

Please dispose of according to your local recycling laws and regulations.

NORBAR TORQUE TOOLS LTD

Wildmere Road, Banbury,
Oxfordshire, OX16 3JU

UNITED KINGDOM

Tel + 44 (0)1295 270333

Email enquiry@norbar.com

For the most up-to-date
version of the Operator's
Manual, please scan the
QR code below.



To find your local
Norbar company or
distributor, please scan
the QR code below.



www.norbar.com